



WEST • (FRONT) • ELEVATION

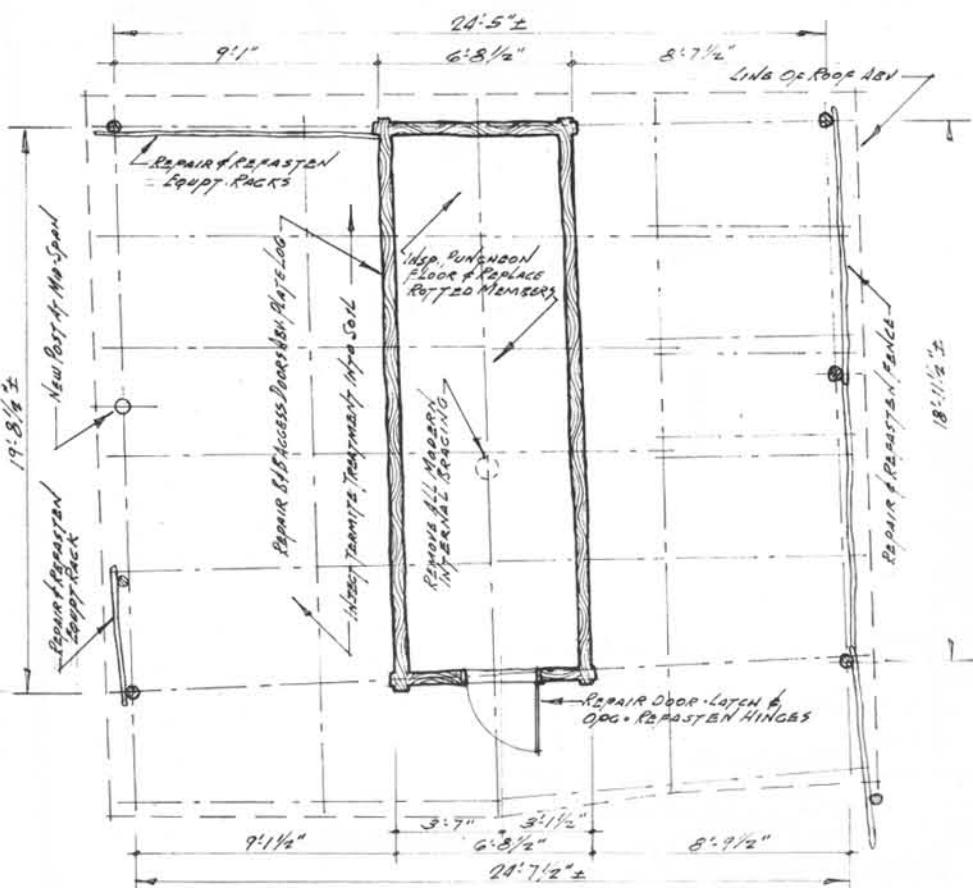


**FLOOR PLAN**


BASIC DATA FIELD MEASUREMENTS BY R. JONES - 11-68-

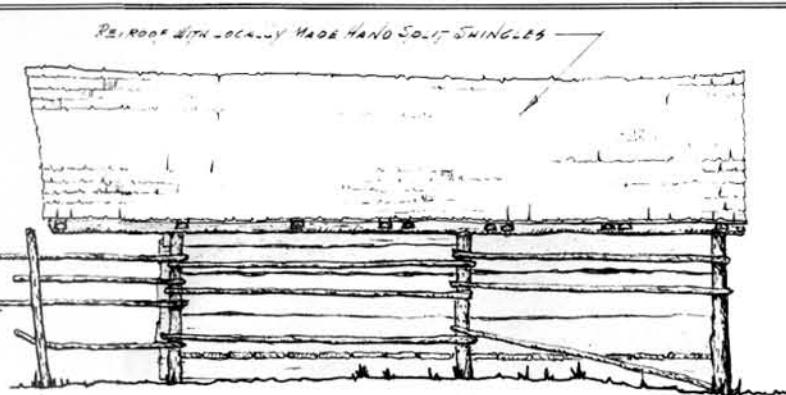

SOUTH ELEVATION.

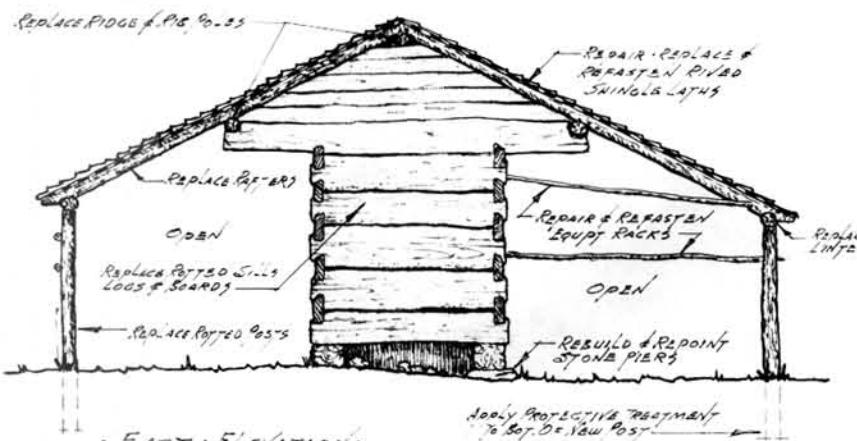

EAST ELEVATION

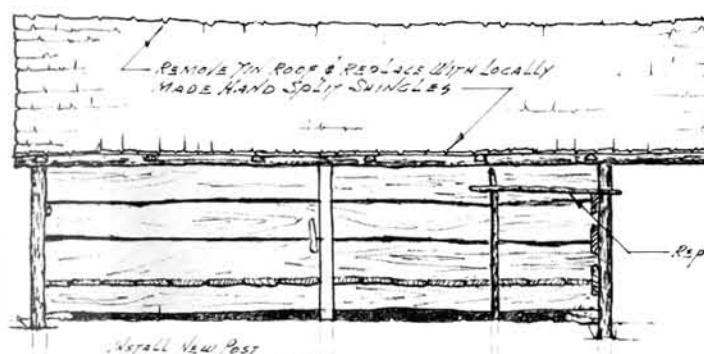

• NORTH • ELEVATION •

SYMBOL	DESCRIPTION OF REVISION	DATE	SURNAME
		REGION	DRAWING NO.
	<b>UNITED STATES DEPARTMENT OF THE INTERIOR NATIONAL PARK SERVICE OFFICE OF ARCHEOLOGY AND HISTORIC PRESERVATION DIVISION OF HISTORIC ARCHITECTURE</b>	<b>SOUTHEAST</b>	<b>PCP B-296</b>
<i>RESTORATION WALKER SISTERS COMPLEX</i> * LITTLE GREENBRIER * Little Greenbrier, NC * GREAT SMOKY MOUNTAINS NAT'L PK. * NAME OF PARK		133	94001
SHEET TITLE • CORN Crib • RESTORATION •		DATE 7-3-69	
		SHEET 2 OF 2	

#### GENERAL NOTES AND SPECIFICATIONS

1. **WORKMANSHIP** - All work shall be performed by artisans skilled in log construction, employing original methods and techniques. When it is necessary to replace portions and components of the building, the existing item shall be used as a model. The restored structure shall retain the primitive character of the original building.
  2. **STONE FOUNDATION** - Repair, repoint, and rebuild where necessary using existing stones gathered at the building site.
  3. **LOG WALLS** - Replace all unsound wall logs and boards. Renew all loose boards. Logs shall not be spliced.
  4. **SHEETS** - Replace unsound posts supporting the two lintel. Install new post as indicated at north shed. Buried end of new post shall be painted with asphalt or similar protective coating. Inspect shed lintels and replace as necessary. Replace damaged fence rails and post at south shed. Refasten rails. Buried portions of fence post to be given protective coating.
  5. **ROOF** - Remove all modern internal roof bracing. Replace ridge and rib poles. Install new rafters (double rafters on south shed to be removed). Replace shingle laths as required. Reroof using locally made hand split shingles. New shingles to be the same size and thickness and laid with the same exposure as the original shingles.
  6. **DOOR** - Repair door and wood bar and replace missing parts to make operative. Refasten hinges.
  7. **PUNCHED FLOOR** - Inspect puncheon floor and replace any unsound puncheons. Paint underside with asphalt before installation.
  8. **MISC. ITEMS** - Replace missing pegs as indicated by holes in the wall logs.
  9. **COLOR TREATMENT** - All replacement wood members, after being cut, sized, notched, etc., but before installation shall be colored to match adjacent wood. The technique and method of coloring shall be at the discretion of the project supervisor.
  10. **PRESERVATIVE AND WATERPROOFING TREATMENT** - All new timbers after cutting, notching, etc., but before installation shall be given a preservative treatment according to the manufacturer's directions. The manufacturers instruction for the chemical used. The bottom surface of all wall logs in contact with the stone foundation and all notches, scores, cuts, etc., shall be painted with coal-tar creosote in such a manner as not to be visible when assembled. Existing timbers shall be treated in a like manner.
  11. **TERMITE TREATMENT** - All ground under the building; and for note less than two feet outside of the building perimeter shall be injected with a commercial termite treatment in accordance with the manufacturer's directions for the chemical used.
  12. **GRADING** - After all foundation backfill has settled, fill and compact all low areas to bring to grade. Fine grade to a uniform slope of 2 inches in 5 feet to direct surface water away from the building.
  13. **CLEAN-UP** - After all work is completed all trash, debris, construction materials and equipment shall be removed and the site left "Broom Clean".



## ORIENTATION

PREPARED  
5-1569 R. Jones  
DESIGNED  
5-1569 R. Jones  
DRAWN  
CHECKED

**DEPARTMENT OF THE INTERIOR  
NATIONAL PARK SERVICE  
OFFICE OF ARCHEOLOGY AND HISTORIC PRESERVATION  
DIVISION OF HISTORIC ARCHITECTURE**

~~TORATION~~ • WALKER SISTERS COMPL.  
• LITTLE GREENIER •  
LOCATION WITHIN BARK  
GREAT SMOKY MOUNTAINS NATL. PK.

**CORN CRIE RESTORATION.**

133  
94001

SHEET 2 OF 2