UNITED STATES DEPARTMENT OF THE INTERIOR NATIONAL PARK SERVICE

### NATIONAL REGISTER OF HISTORIC PLACES INVENTORY -- NOMINATION FORM

FOR NPS (	SE ON V	
RECEIVED		
DATE ENT	DEN	
		20525625

EOR EEDER AL PROPERTIES	DATE	ENTERED	
FOR FEDERAL PROPERTIES	O COMPLETE MATION	AL DECIDED FORM	
SEE INSTRUCTIONS IN <i>HOW T</i> TYPE ALL ENTRIES (			Ĭ
1 NAME			
HISTORIC Old Faithful Inn			
AND/OR COMMON			
Old Faithful Inn			
2 LOCATION			
STREET & NUMBER Old Faithful		NOT FOR PUBLICATION	
CITY TOWN Yellowstone National Park	. VICINITY OF	CONGRESSIONAL DISTR	ICT
STATE Wyoming	CODE 56	COUNTY Teton	CODE 029
2 CLASSIFICATION		10001	
CATEGORY OWNERSHIP	STATUS		ENT USE
DISTRICT X_PUBLIC X_BUILDING(S) PRIVATE	X_OCCUPIED	AGRICULTURE	MUSEUM
&_BUILDING(S)PRIVATESTRUCTUREBOTH	UNOCCUPIED	X COMMERCIAL	PARK
SITE PUBLIC ACQUISITION	WORK IN PROGRESS  ACCESSIBLE	EDUCATIONAL ENTERTAINMENT	PRIVATE RESIDENC
OBJECTIN PROCESS	X_YES: RESTRICTED	GOVERNMENT	RELIGIOUS
BEING CONSIDERED	X_YES: UNRESTRICTED	INDUSTRIAL	TRANSPORTATION
	_NO	MILITARY	_OTHER:
4 AGENCY			
,			
REGIONAL HEADQUARTERS: (If applicable)	Mountain Pagional	Off1 ao	
National Park Service Rocky STREET & NUMBER	Mountain Regional	OTITCE	
	25289		
655 Parfet Street P. O. Box	23207	STATE	
Denver	- VICINITY OF	Colora	do
5 LOCATION OF LEGAL DESCR	RIPTION		
COURTHOUSE;			
REGISTRY OF DEEDS, ETC. National Park Ser	rvice Rocky Mou	ntain Regional Of	fice
STREET & NUMBER			
655 Parfet Street P. O. Box	25287		
CITY, TOWN	<u> </u>	STATE	
Denver		Colorado	
6 REPRESENTATION IN EXIST			
TITLE 1) List of Classified Struct			
2) National Register of Hist	toric Places		
DATE 1) 1978			
2) 1973	X-FEDERAL _	STATE _COUNTY _LOCAL	
DEPOSITORY FOR SURVEY RECORDS National Park Service	ce		
CITY, TOWN		STATE	
Washington		D. C.	

#### 7 DESCRIPTION

#### CONDITION

\_UNALTERED

CHECK ONE

\_\_EXCELLENT \_\_GOOD

X\_FAIR

\_\_DETERIORATED

\_\_UNEXPOSED

\_\_RUINS

X\_ALTERED

X-ORIGINAL SITE

\_\_MOVED DATE\_\_\_\_

#### DESCRIBE THE PRESENT AND ORIGINAL (IF KNOWN) PHYSICAL APPEARANCE

Old Faithful Inn is a massive building within, a short viewing distance of Old Faithful Geyser, the most famous geyser in the United States. The building is an exposed log and wood-frame structure of rustic design and gigantic proportions: nearly 700 feet in length and a central core seven stories high. The building was constructed in three major phases: the 1903 original section (known as the Old House) with the imposing gable roof, dining room and kitchen wings to the south, and small guest-room wings to the east and west; the 1913-14 east wing; and the 1927 west wing. The building faces north, oriented toward the old "circuit road" rather that toward the geyser. The building was designed by architect Robert Reamer.

The foundation of the 1903 portion is stone, or concrete with a stone veneer. The first floor structure consists of load-bearing log walls, and log framing. Upper stories are of milled lumber and log framing, and are sheathed with yard-long shingles on the The two bottom shingle courses have lower edges sawn in a diamond pattern. The central portion of the building, with its massive gable roof is the dominant architectural feature on the exterior. The roof comprises six of the seven stories. widow's walk with five flagstaffs at its edges surrounds the top of the roof. At one time the widow's walk did have spotlights to light nightime viewing of old Faithful, but these were removed in The main gable roof is pierced by three stories of dormers and multi-light casement windows on the gable ends that provide natural light to the lobby and guest rooms. Two dormers have false windows which are presumably for exterior decoration only. Projecting out from the eaves of the main gable are outlookers supported by gnarled log brackets (outriggers).

The original porte-cochere was recessed under the large gable roof of this central portion, along with a second-story porch directly above it. When the porte-cochere was extended out in front of the building in 1927, a portion on the ground floor was enclosed and became part of the lobby. The second-story porch was also extended out to provide for better viewing of Old Faithful geyser; this extension was not roofed. Piers supporting the porte-cochere and porch are surrounded by battered log cribbing, adding distinction to the structure. The two original wings are three and a half stories in height and flank the central portion to the east and west. The second story overhangs the first story by two feet. These small wings have multiple gable roofs pierced by dormers of varying sizes. the exception of the large plate glass windows on the north side of the lobby, windows in the Old House are usually single and paired casements with various multi-light patterns of diamonds,

#### 8 SIGNIFICANCE

PERIOD	AH	REAS OF SIGNIFICANCE CH	IECK AND JUSTIFY BELOW	
PREHISTORIC	ARCHEOLOGY-PREHISTORIC	COMMUNITY PLANNING	LANDSCAPE ARCHITECTURE	RELIGION
1400-1499	ARCHEOLOGY-HISTORIC	CONSERVATION	LAW	SCIENCE
<u>1500-1599</u>	AGRICULTURE	ECONOMICS	LITERATURE	SCULPTURE
1600-1699	XARCHITECTURE	EDUCATION	MILITARY	SOCIAL/HUMANITARIAN
1700-1799	ART	ENGINEERING	MUSIC	THEATER
1800-1899	COMMERCE	EXPLORATION/SETTLEMENT	PHILOSOPHY	TRANSPORTATION
*1900 Prese	nt_communications	INDUSTRY	POLITICS/GOVERNMENT	_OTHER (SPECIEV)
		INVENTION		

SPECIFIC DATES 1905-4; 1913-14; 1927 to BUILDER/ARCHITECT Robert Reamer, Architect

STATEMENT OF SIGNIFICANCE

Old Faithful Inn is one of the few remaining log hotels in the United States. The Inn is a masterpiece of rustic architecture in its stylized design and fine craftsmanship. Its influence on American architecture, particularly park architecture, was immeasurable in its uses of natural materials to create a feeling of high-style rusticity. In a broad sense the design of the Inn parallels architectural ideas being used in hotel construction today with its enormous multi-story lobby surrounded by levels of galleries.

Old Faithful Inn undoubtedly is the queen of rustic hotels in the national parks. Its use of natural materials, allusions to pioneer building techniques, and strong ties with its site through the use of onsite materials are three key principles of rustic design with which National Park Service architects worked through World War II. The log walls, gnarled log brackets and balustrades, and natural finishes on the warm wood on the interior no doubt relate back to the work of William West Durant in his Adirondack buildings of the 1870s. The sheer scale of the building and the extreme exaggeration of many of its architectural features leave the building with a western frontier sense of size, space, and grandeur. Certain anglo-colonial features such as the second-story overhang and the diamond-mullioned windows cannot be overlooked, but they are subdued by the overall rustic character of the building.

The Northern Pacific Railroad and its former subsidiary the Yellowstone Park Association financed the construction of Old Faithful Inn at a cost of approximately \$140,000, with an additional \$25,000 for furnishings. The Department of the Interior gave permission for building materials such as stone, timber, and clay for bricks to be gathered within the park boundaries. The Association chose Robert Reamer as architect for the building. Reamer was originally from Ohio, and had worked for the New York, New Haven, and Hartford Railroad before coming west with the Northern Pacific to design their Gardiner, Montana depot. He was 29 when the Association hired him to design the Inn, and he was said to have "sketched the plans while coming shakily out of a monumental submersion in malt, and some authorities claim to be able to read that fact in its unique

#### 9 MAJOR BIBLIOGRAPHICAL REFERENCES

See Attached.

10 GEOGRAPHICAL D ACREAGE OF NOMINATED PROPERT		_	
UTM REFERENCES			
A 1 . 2 5 1.3 4.9.5 ZONE EASTING C 1 1 1 1	4, 9, 2, 2, 7, 1,0 NORTHING	B ZONE EASTING	NORTHING
VERBAL BOUNDARY DESCRIP			
The Boundary is the Faithful Inn and w		n the enclosed Sit	e Planning Map of Old
LIST ALL STATES AND C	COUNTIES FOR PROPERT	TIES OVERI APPING STATE	OR COUNTY BOUNDARIES
STATE	CODE	COUNTY	CODE
STATE	CODE	COUNTY	CODE
Laura Soullière Harr ORGANIZATION  National Park Service STREET & NUMBER P.O. BOX 728		itectural Historia	DATE 1985 TELEPHONE 05-988-6787
CITY OR TOWN Santa Fe			STATE New Mexico
12 CERTIFICATION O		ON ON OFFICER RECOMMEND	DATION
		NONE	-
			STORIC PRESERVATION OFFICER SIGNATURE
In compliance with Executive Orde Historic Preservation Officer has be evaluate its significance. The evaluate FEDERAL REPRESENTATIVE SIGN	een allowed 90 days in w ated level of significance is	hich to present the nominat	onal Register, certifying that the State ion to the State Review Board and to Local.
TITLE			DATE
OR NPS USE ONLY I HEREBY CERTIFY THAT THIS P	ROPERTY IS INCLUDED	IN THE NATIONAL REGIST	<b>a</b>
	하이 나이를 걸게 있습니다. 요한 물론이 되었습니다.		DATE
DIRECTOR, OFFICE OF ARCHEO	LOGY AND HISTORIC PI	RESERVATION	DATE
KEEPER OF THE NATIONAL REG	ISTER		

# National Register of Historic Places Inventory—Nomination Form



Continuation sheet

Item number 7

Page 2

circles, and rectangles.

Access into the front (north) of the building is through a door constructed of large planks with wrought iron hinges and a lock forged on-site by a blacksmith. Undoubtedly the most impressive space in the interior is the seven-story lobby that climbs ninety-two feet from the floor. The lobby is surrounded by two levels of balconies built on log framing. The lower balcony encircles all four walls of the lobby and provides access to the porches over the porte-cochere on the north side and overlooks the dining room on the south side; the upper balcony is L-shaped in plan and runs along the north and west walls. Supporting the main gable roof are a series of trusses, oriented east-west, that are in turn supported by the log framing below. Climbing up from the second balcony is a staircase leading up to the "Crow's Nest"--a separate small landing near the roof where musicians played for the enjoyment of guests far below during the early days of the Inn. The gnarled log brackets attached to the log columns of the framing serve no structural purpose, and were put there solely for decoration. Similar rustic log work is used for balcony railings, balustrades along staircases, and brackets under the eaves. Stair treads are half-logs. The structural logs of the interior spaces originally had bark on them but now are peeled. The ceilings in the lobby are half-logs laid to look like a purlin roof.

A stone fireplace, sixteen feet square at its base, dominates the southeast corner of the lobby. The upper portion of the fireplace on the north side holds a massive wrought-iron and brass clock, designed by Reamer. The chimney, exposed on the interior, is of stone masonry. The original stack on the exterior was of brick construction, sheathed with log cribbing similar to that of the piers for the porte-cochere.

The original dining room to the south of the lobby has a roof structure of exposed log scissors trusses. Ceiling and walls are exposed half-logs and logs, respectively. A large stone fireplace is centered on the south wall, constructed of the same rubble masonry as the lobby fireplace.

Hallways at the east and west of the lobby lead to guest rooms in the wings of the Old House. Guest rooms in both of these wings retain considerable original character. Those on the first floor have rustic log walls. Interior finishes for guest rooms on the upper stories are rough-sawn paneling on walls and ceiling. Some of these rooms retain original plumbing fixtures: clawfoot bathtubs, wood water closets, and marble sink tops.

# National Register of Historic Places Inventory—Nomination Form



Continuation sheet

Item number 7

Page 3

Throughout the Old House are original furnishings adding to the integrity of the building and its spaces. The lobby contains Mission furniture: loose-cushioned setees, rockers, arm chairs, wing-back chairs, octagonal base tables with leather tops and brass studded trim, writing desks and chairs. The dining room still has the original rustic hickory chairs from the Old Hickory Furniture Company. Leather-topped tables with brass studs are in the Bear Pit. Some of the bedrooms have the original iron bedsteads, dressers, and wash stands. Also contributing to the interior integrity of the Old House are the original electric lighting fixtures: copper and iron chandeliers in the lobby and dining room; and wood candelabra of rustic design serving as the capitals of the log columns supporting the balconies.


The building has undergone many changes in its eighty-two-year history. The east wing of the Inn, containing 100 additional guest rooms, was constructed in 1913-14. The east wing is connected to the original section by a two-story passageway. upper story of the passageway is open, and edged with rustic railings and fretwork. The lower story is enclosed. The east wing proper is of frame construction and is three stories in height. Exterior walls are covered with cedar shingles. Corners of this wing are articulated by log cribbing and three-story log outriggers resting on a rubble-veneered concrete foundation. Other sections of the foundation are concrete sheathed with logs. The roof is flat, with shed extensions running the lengths of the long sides. Windows are double hung, with ten lights above and one below. The east wing has undergone few changes other than cosmetic ones since construction, but has no outstanding interior features. A steel frame fire escape and concrete handicapped access ramp were added on the exterior of the eastern end of this wing during the early 1980s.

A guest room in the northwest corner of the lobby was remodelled into an art gallery in 1915. An addition was constructed on the dining room in 1922. A concrete platform to serve as a loading dock for the kitchen at the rear of the building was constructed in 1923. That same year the red-painted cedar shingles of the roof were replaced, but only portions of the new roof were painted red. Changes to the lobby in 1923 included moving the registration desk from the southwest to the northeast corner, and creating a bellhop's desk by removing two guest rooms opposite the new registration desk. Some structural work was done to replace the support provided by the load-bearing walls of the guest rooms that were removed. Existing fire escapes were updated in 1925. A concrete floor was poured around the base of

### National Register of Historic Places Inventory—Nomination Form

Continuation sheet

Item number 7



Page 4

the fireplace in the lobby in 1926.

The west wing was constructed in 1927. It added 150 guest rooms and 95 bathrooms to the Inn. The west wing is Y-shaped in plan. Exterior siding is cedar shingles. A two-story lobby space connects this wing with the 1903 section. The wing is four stories in height, and is of wood frame construction with a concrete foundation. The roof is flat, with a mansard edge around the fourth floor (not a true mansard roof). The mansard edge is consistently broken by the shed-roofed dormers of the fourth floor windows. A four-story bay with log exterior corners houses the staircase at the western end of the wing. Windows are six-over-six and eight-over-one double hung. The interiors have undergone periodic updating, particularly from 1975-77 when one hundred rooms were rehabilitated. The west wing contains no outstandingly significant interior features.

During 1927 the lobby was expanded. The north wall was removed and extended forward to the porte-cochere. Timber columns were put in the place of the old wall to support the balconies above. The original door and windows were used in the new front wall. At the same time the porte-cochere was extended to the north, as detailed earlier. The east and west walls of the lobby were extended several feet to the north. Five guest rooms on the northwest corner of the original structure were removed to make room for gift shops. That same year a third multi-sided addition was constructed on the dining room.

In 1932, the entire roof of the Old House was painted red. The Bear Pit cocktail lounge was constructed to the west of the lobby between the western wing of the Old House and the kitchen addition at the rear (southwest) of the building. Logs in the lobby were peeled and treated in 1940, and bark was removed at that time. The dining room floor was replaced at the same time. In approximately 1943, some diagonal timbers were added to the truss system to better support the lobby roof during heavy snows. During 1947-48, the roof of the original section, except for the dining room, was reshingled. A Grinnell sprinkler system was added then, and fire doors were installed in the east and west wings. The dining room was re-roofed in 1953.

The building withstood an earthquake in 1959, but the the dining room fireplace collapsed and caused considerable roof damage which was repaired. The earthquake also caused damage to the lobby chimney stack, causing bricks to block two of the four flues. The steel stack braced by guy wires replaced the old chimney above the roof line at that time.

# National Register of Historic Places Inventory—Nomination Form



Continuation sheet

Item number 7

Page 5

In 1962, the Bear Pit bar was converted to a coffee shop, and the eastern portion of the dining area became the new Bear Pit. The present Indian art shop was placed in the northwest corner of the lobby in 1964. Original plumbing pipes were replaced with copper pipes during 1960-1965. In 1968 windows on the upper portion of the south wall of the original dining room were filled in. Following a cleaning with compressed air in 1971, the lobby woodwork including the logs on the underside of the roof was coated with a clear satin varnish. A concrete ramp for wheelchair access was added on the west side of the porte-cochere. The main gable roof, its dormers, and some sections of exterior walls were reshingled in the early 1980s. Some wood structural repairs were made under the same contract. Fire escapes were constructed on the east and west wings in 1980. The interior spaces of the kitchen were completely rebuilt and remodelled in 1981-82. In 1983 a series of changes included the addition of smoke enclosures and public restrooms in the old west wing, new restrooms in the old house and wings, piping and tunnel improvements, and new wiring and fixtures at the front desk. Plans are underway now to restore the integrity of the lobby space.

The building is closed during the winter, but remains open the rest of the year. Thousands of visitors each year partake of the spatial experiences of walking under the porte-cochere, into the rustic lobby, up on the balconies, and out on the porch to watch Old Faithful erupt. Most do not stay at the Inn; but they are drawn to the building because of the sense of place it creates. They come to Old Faithful Inn to experience the visual and tactile luxury of what one architect and hundreds of skilled craftsmen did with wood and stone.

### National Register of Historic Places Inventory—Nomination Form



Continuation sheet

Item number 8

Page 2

contours."[1]

The Yellowstone Park Association, after suffering the loss by fire of the Upper Geyser Basin Hotel, was under pressure by the federal government to provide good tourist accommodations in that area. What the Yellowstone Park Association needed was lodging to house the great numbers of visitors coming to the area by train. They wanted a building constructed just at the legislated 1/8-mile distance from Old Faithful geyser, built out of as many available materials as they could use from the area to defray costs, but with an identifiable character.

What they ended up with is a unique structure that in some ways became a destination in itself, and a building that enhanced the visitor's western frontier/park experience. The building retains today that strong sense of place. More than any other building in any national park, Old Faithful Inn not only met but far exceeded the concessioner's ideas for development.

Key to the understanding of this building is architect Robert Reamer's extravagant use of space and materials. The architect's vision was enormous. The seven-story lobby built out of log and frame is unique in American architecture. Its incredibly large space can be experienced on many different levels and from many different vantage points. The visitor can stand in the middle of the lobby and look up at the exposed structure, or climb up a gnarled log staircase to one of the balconies and look up, down, or across. Prior to the 1959 earthquake visitors could even climb up the highest staircases to the roof. The lobby is a fantasy land of gnarled wood and unusual inviting places to experience at a variety of levels. The sheer enormity is counteracted by the warmth and tactile qualities of the materials: the rough shingles, the gnarled wood, the multi-light windows. The original guest rooms have a coziness about them with their log or wood panelled walls. The window seats and diamond patterned multi-light windows add to that warm feeling. As one visitor in 1905 commented: "And then we came to the Inn, the most unique and perfect place; it is the craftsman's dream realized. My room alone is a paradise of restfulness though in a rough and rustic fashion."[2]

Reamer did not repeat his heavy-handed, baroque use of materials in the 1913 and 1914 wings. The original building's emphasis on battered foundations and axe-cut log work was not repeated with the same success as in the original structure. The additions were not nearly the architectural quality of the original structure, but at least they were designed with relative

# National Register of Historic Places Inventory—Nomination Form



Continuation sheet

Item number 8


Page 3

compatibility. The rustic sense remained overhwelming.

The success of Old Faithful Inn's sense of place and image undoubtedly had an impact on development funded by railroads and concessioners in other national parks. Initial construction costs often ended up being small in comparison to the image that Image meant tourism, and tourism meant business. they bought. The Santa Fe Railway recognized this two years later at Grand Canyon when they began constructing El Tovar. Other railroads followed suit. Large hotel chains today are still emphasizing distinction in exterior design and multi-story lobby spaces as much as Reamer did in Old Faithful Inn. The Hyatt Regency in San Francisco, the Clarion in St. Louis, the Bonaventure in Los Angeles, and numerous others throughout the nation all have unusual exterior design that separates them from the glass and steel boxes around them. Also, they all have enormous multi-story lobbies that are gathering places for their guests and for city residents who enjoy watching the activities below from the concrete and steel balconies and who like to ride the glass enclosed elevators to experience the spatial sequences from different viewpoints. Reamer did exactly the same thing in the Old Faithful lobby with his balconies and staircases. Although he was not the first to design a multi-story hotel lobby [3], Reamer was the first to do it in natural materials in such a massive scale. Today the materials are very different -- steel, glass, concrete, and high-tech lighting systems, rather than gnarled logs and rough-sawn wood. And the feeling is very different -- urban, noisier, and flashier, rather than warm and comforting. But the end result is the same. People enjoy experiencing different spaces and the feelings they evoke, and enjoy interacting with others doing the same thing. In a natural setting Reamer created one of the most enjoyable architectural experiences in any national park.

- [1] Robert Shankland, Steve Mather of the National Parks (New York: Alfred A. Knopf, 1954), p. 117.
- [2] Susan Scofield and Jeremy Schmidt, The Inn at Old Faithful, (Crowsnest Associates, 1979), p. 23.
- [3] The concept of a hotel with a multi-story lobby surrounded by galleries developed as an American phenomenon. Asher Benjamin designed the first in 1806—the Exchange Coffee House in Boston with five levels of galleries surrounding a central lobby—less than 100 years prior to Old Faithful. Although the Coffee House housed additional functions, its upper stories contained hotel accommodations.

# **National Register of Historic Places Inventory—Nomination Form**



Continuation sheet

Item number 9

Page 1

Clemensen, A. Berle. <u>Historic Structure Report, Historical Data Section</u>, Old Faithful <u>Inn</u>, Yellowstone National Park, Wyoming. Denver: National Park Service, Denver Service Center, 1982.


National Park Service files including LCS and National Register files, and various construction documents.

Pevsner, Nikolaus. A History of Building Types. Princeton, New Jersey: Princeton University Press, Bollingen Series XXXV--19, 1976.

Scofield, Susan and Jeremy Schmidt. The Inn at Old Faithful. Yellowstone National Park (?): Crowsnest Associates, 1979.

Shankland, Robert. Steve Mather of the National Parks. New York, Alfred A. Knopf, 1954.

Tweed, William C., and Laura E. Soulliere and Henry G. Law. National Park Service Rustic Architecture: 1916-1942. San Francisco: National Park Service, 1977.

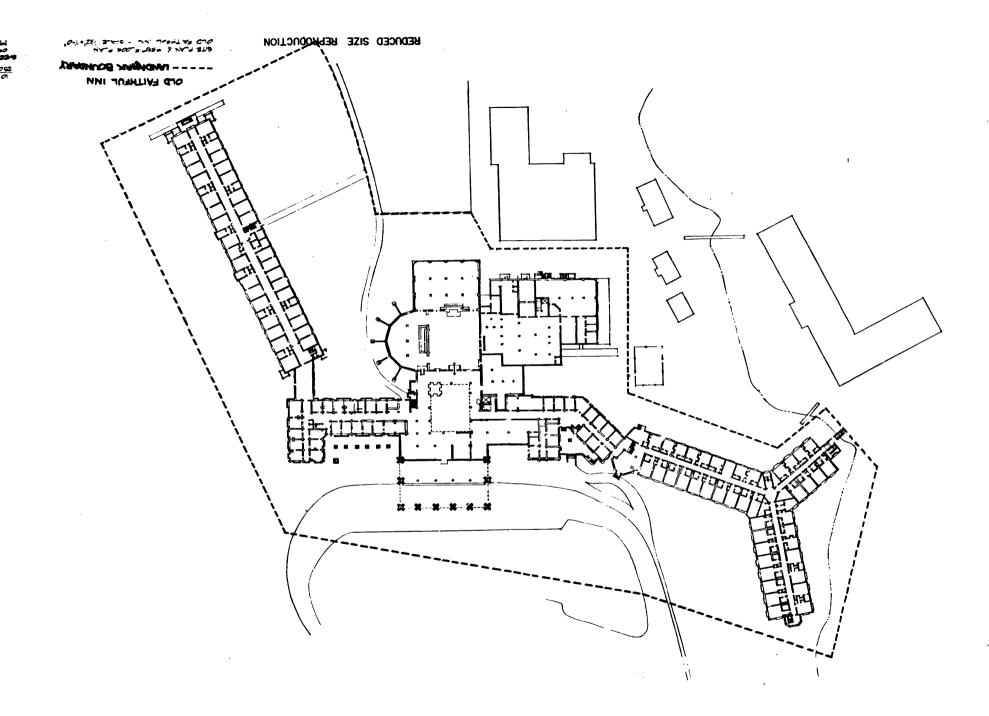



Old Faithful Inn Yellowstone National Park NPS Photo by Laura Soulliere Harrison Old House and west wing



Old Faithful Inn Yellowstone National Park NPS Photo by Laura Soulliere Harrison West Wing addition



Old Faithful Inn Yellowstone National Park NPS Photo by Laura Soulliere Harrison East Wing



Old Faithful Inn Yellowstone National Park NPS Photo by Laura Soulliere Harrison Eastern corner of the Old House, with east wing in the background



Old Faithful Inn Yellowstone National Park NPS Photo by Laura Soulliere Harrison Western portion of original structure



Yellowstone National Park NPS Photo by Laura Soulliere Harrison Porte-cochere and front entrance from the southeast

Old Faithful Inn



Yellowstone National Park NPS Photo by Laura Soulliere Harrison Porte-cochere and front elevation from the west

Old Faithful Inn




Old Faithful Inn Yellowstone National Park NPS Photo by Laura Soulliere Harrison Service door off porte-cochere, Old House




Old Faithful Inn Yellowstone National Park NPS Photo by Laura Soulliere Harrison 7/85 Second story rustic porch



Old Faithful Inn Yellowstone National Park NPS Photo by Laura Soulliere Harrison Rustic staircase from third floor balcony up to Crow's Nest 7/85

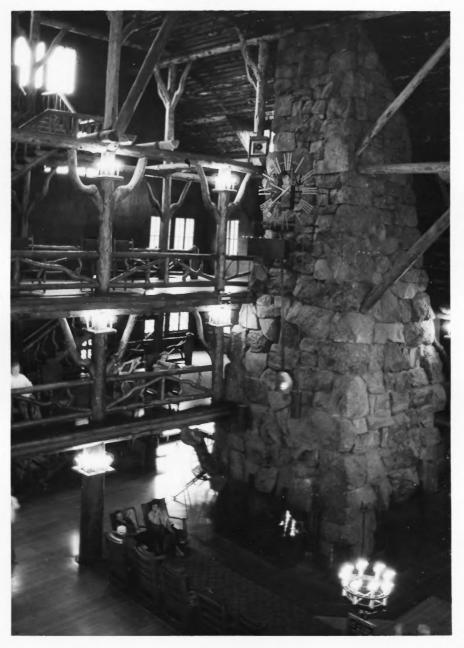

Old Faithful Inn Yellowstone National Park NPS Photo by Laura Soulliere Harrison 7/85 Stone fireplaces and chimney with clock, lobby

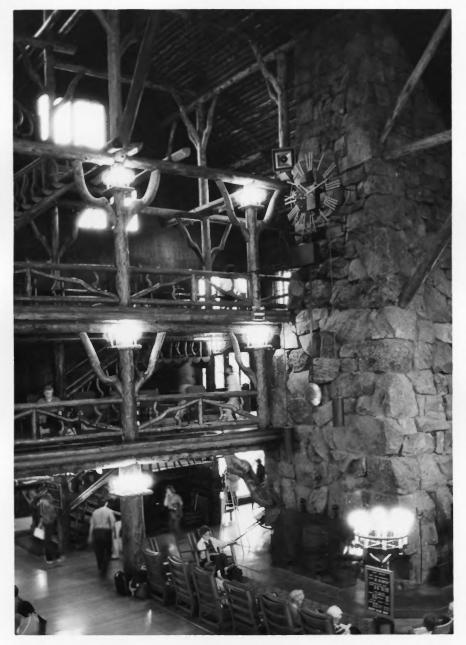

Lobby balconies, fireplace, and chimney clock Old Faithful Inn Yellowstone National Park NPS Photo by Laura Soulliere Harrison

(NHL file)



Old Faithful Inn Yellowstone National Park NPS Photo by Laura Soulliere Harrison 7/85 Second and third floor balconies, lobby



Old Faithful Inn vellowstone National Park NPS Photo by Laura Soulliere Harrison 7/85 Lobby: Ground floor and balconies



Old Faithful Inn Yellowstone National Park NPS Photo by Laura Soulliere Harrison 7/85 Multi-level balconies in lobby of Old House



Old Faithful Inn Yellowstone National Park NPS Photo by Laura Soulliere Harrison Third floor balcony with split level up to guest rooms, Old House




Old Faithful Inn Yellowstone National Park NPS Photo by Laura Soulliere Harrison Additional landings from third floor balcony up to Crow's Nest



Old Faithful Inn Yellowstone National Park NPS Photo by Laura Soulliere Harrison Original furnishings, balcony level



Old Faithful Inn Yellowstone National Park NPS Photo by Laura Soulliere Harrison Mission furniture, balcony level, lobby

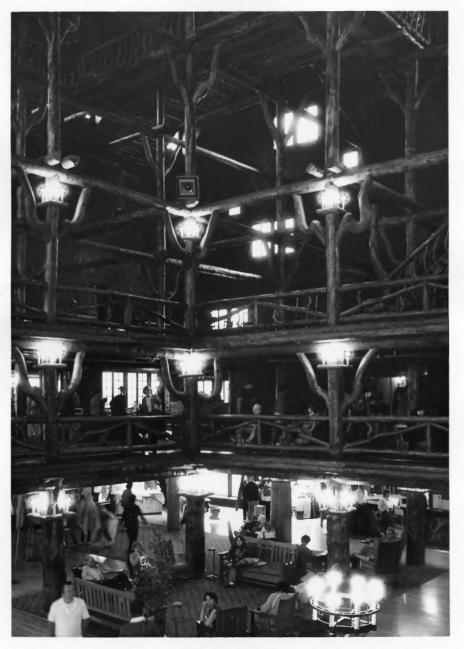

Lobby with balconies and rustic log structure. Old Faithful Inn Yellowstone National Park NPS Photo by Laura Soulliere Harrison



Old Faithful Inn Yellowstone National Park NPS Photo by Laura Soulliere Harrison Service door off porte-cochere, Old House



Built-in closet in guest room of Old House Old Faithful Inn Yellowstone National Park NPS Photo by Laura Soulliere Harrison



Original furniture and rough-sawn panelling. in guest room of Old House Old Faithful Inn Yellowstone National Park NPS Photo by Laura Soulliere Harrison 7/85



Original porcelain sink in guest room of Old House Old Faithful Inn Yellowstone National Park NPS Photo by Laura Soulliere Harrison



Marble sink and other original plumbing fixtures in guest suite of Old House Old Faithful Inn Yellowstone National Park NPS Photo by Laura Soulliere Harrison



Old Faithful Inn Yellowstone National Park NPS Photo by Laura Soulliere Harrison Portion of guest suite with original furnishings, Old House



Historic bathroom. Old House. Old Faithful Inn Yellowstone National Park NPS Photo by Laura Soulliere Harrison



Historic bathroom with original plumbing fixtures. Old Faithful Inn Yellowstone National Park NPS Photo by Laura Soulliere Harrison